

Aquaflash 500 Installation Instruction

- * Note: A Termination Bar is required for surface-mounted applications.
- 1. Aguaflash 500 should be cut into manageable lengths of approximately 8 to 10 feet.
- 2. Remove the release liner.
- 3. Apply Aquaflash 500 membrane starting from the lowest point and work upwards.
- 4. Once the membrane is in place, use a steel hand roller to secure the flashing firmly in place.
- 5. All side laps should be a minimum of 4". Either trim edges or lay the membrane 1/2" back from face of masonry.
- 6. After installing the overlapping section of flashing, apply a ½" thick bead of Aquaflash 500 Mastic along the joint and tool it down to $\frac{1}{4}$ " with an $1-\frac{1}{2}$ " wide putty knife.
- 7. * Install Termination Bar at the top of the flashing to secure it to the backup.
- 8. Inside and outside corners must be covered with two layers of membrane and sealed with mastic.

Once installed, no maintenance is required.

Note: Not to be used for exposed flashing.

Not to be applied below 25°F Not to be applied below 40°F without a primer Not to be used with oil based, wax based or polysulfide sealants or creosote. Rubberized asphalt flashings not to be exposed for more than 3-4 weeks.

Repairs:

Aquaflash repairs are made by using a piece of Aquaflash cut to extend 6" in all directions from the edge of the affected area. The piece used should be put in place by using a hand roller.

Storage:

Temperature not to exceed 120° Fahrenheit or go below 25° Fahrenheit.

Protect products from inclement weather or excessive heat.

Sizes: Standard Widths: 12", 16", 18" 24", 36" Standard Length: 50 lineal feet.

Corporate Office: 400 Rountree Rd Charlotte. NC 28217

TEL: (800) 849-6722 FAX: (704) 525-3761

Mailing Address: P.O. Box 240988 Charlotte, NC 28224



Memphis Plant: 2365 Harbor Ave. Memphis, TN 38113

TEL: (800) 441-8359 FAX: (901) 775-9449

Mailing Address: P.O. Box 13124 Memphis, TN 38113

www.wirebond.com